



Photo 1 (top) – June 2009

Facing south along the east highway ditch adjacent to the cut slope. The rockfall debris from this cut slope is contained within the existing ditch.



Photo 2 (bottom) – 2005

Facing north along the east highway ditch, across the same area shown in Photo 1. At the time of the 2005 inspection there was a significant accumulation of up to boulder-sized rockfall debris along the ditch.