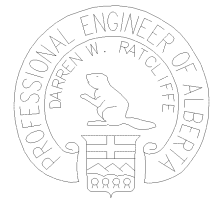


SITE NUMBER AND NAME C18 H837:02 Riverbank Slide		HIGHWAY & KM 1.9	PREVIOUS INSPECTION DATE June 14, 2012	INSPECTION DATE May 16, 2013
LEGAL DESCRIPTION 28-29-21-W4	NAD 83 COORDINATES N 5708370 E 369940		RISK ASSESMENT PF: 2 CF: 2 TOTAL: 4	

SUMMARY OF SITE INSTRUMENTATION: None	INSPECTED BY: 
LAST READING DATE:	
PRIMARY SITE ISSUE: Riverbank instability	
APPROXIMATE DIMENSIONS:	
DATE OF ANY REMEDIAL ACTION: Gravel berms Oct 2002 and Oct 2005. Vegetation mat Oct 2005. Asphalt curb 2006 (now removed).	

ITEM	CONDITION EXISTS		DESCRIPTION AND LOCATION	NOTICABLE CHANGE FROM LAST INSPECTION	
	YES	NO		YES	NO
Pavement Distress		X	The area was patched in 2003. An asphalt curb was constructed in 2006, but was removed in 2010.		X
Slope Movement		X	The 2002 and 2005 gravel berms are performing well - starting to vegetate and blend in with the existing riverbank. The area about 100 m north of the gravel berm, which was slumping has been in-filled with native material and protected with a vegetation mat. Vegetation is actively growing except where voids are present under the mat. It would be beneficial to cut the mat over the voids and re-staple to restore intimate soil contact.		X
Erosion		X			X
Seepage		X			X
Culvert Distress		X			X
COMMENTS					
Refer to previous inspection reports and attached photos					
The backslope ditch should be cleared of slump material (disposed off-site) as required.					
Highway was repaved and asphalt curb was removed and replaced with guardrail. No bank erosion is apparent at this time.					