

Fence Slide (59+000)



Photo 22.

Downslope edge of the road just south of the stone column stabilisation. Note the cracking / mastic patching in the south-bound lane.



Photo 23.

Area of road stabilised with stone columns. Note the column heads are protruding through the pavement surface by up to 25 mm. There are significant cracks and voids in an arcuate pattern – the cracks are up to 200 mm deep and 50 mm wide.



Photo 24.
In-slope ditch adjacent to the stone column repair. The geomembrane liner in the ditch appears to have been ripped in places.

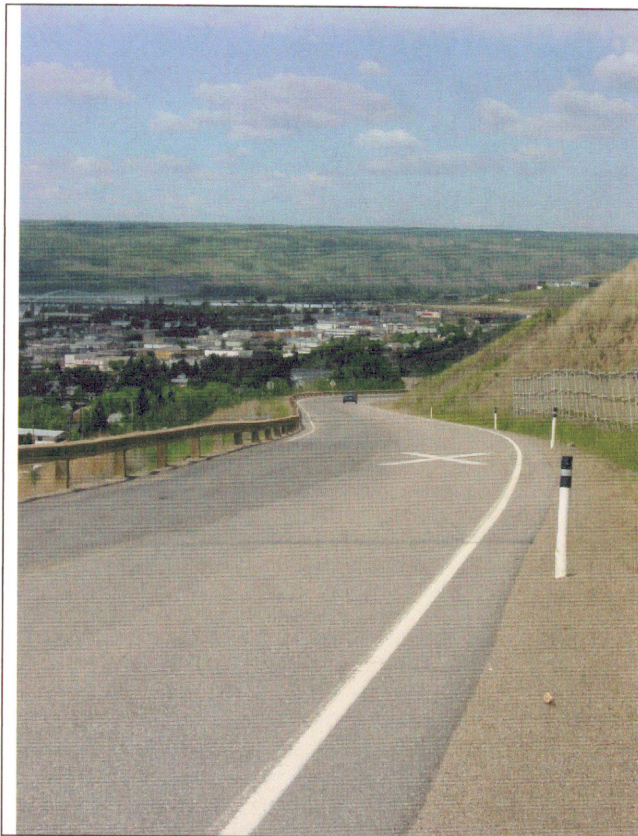


Photo 25.
Area north of the stone columns. There is some minor cracking in the southbound / out-slope lane, mostly in the road shoulder, extending over 40 m of the road.