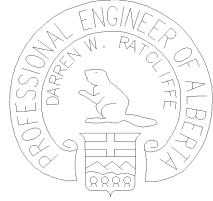


SITE NUMBER AND NAME C24 H564:10 Slide		HIGHWAY & KM 32.29 – 32.47	PREVIOUS INSPECTION DATE Jan 29, 2009	INSPECTION DATE June 4, 2009
LEGAL DESCRIPTION SW 21-27-18-W4	NAD 83 COORDINATES N 5686020 E 396380		RISK ASSESMENT PF: 2 CF: 2 TOTAL: 4	

SUMMARY OF SITE INSTRUMENTATION: None operational	INSPECTED BY: 
LAST READING DATE:	
PRIMARY SITE ISSUE: Large slide below highway. Substantial dip and cracking appeared in highway in 2007 and spring 2008.	
APPROXIMATE DIMENSIONS:	
DATE OF ANY REMEDIAL ACTION: South ditch repaired in fall 2007. Slope repair completed June 30, 2008.	

ITEM	CONDITION EXISTS		DESCRIPTION AND LOCATION	NOTICABLE CHANGE FROM LAST INSPECTION	
	YES	NO		YES	NO
Pavement Distress	X		Road surface reinstated in fall of 2007 and spring 2008. Crack observed in gravel road surface. Cracks typically covered over by road grading operations.	X	
Slope Movement	X		Cracks located on slope bench below highway increased in width since 2008.	X	
Erosion		X	South ditch reinstated with gravel filled geo-cell in fall 2007. Minor migration of gravel from cells.		X
Seepage		X			X
Culvert Distress		X			X

COMMENTS
Refer to previous reports, attached photos, and 2008 construction report.