
To:	Amy Driessen	From:	Leslie Cho and Lawrence Onwude
	Transportation and Economic Corridors		Stantec Consulting Ltd.
File:	123315222	Date:	October 31, 2025

Reference: North Central Region, Edson/Stony Plain, Site NC081 – Highway 16A:08 Evansburg Slide, Fall 2025 Instrumentation Monitoring Report

1.0 OBSERVATIONS

1.1 FIELD PROGRAM AND INSTRUMENTATION STATUS

The Fall 2025 reading cycle consisted of instrument readings of two slope inclinometers (BH21-01 and BH21-02) and four standpipe piezometers (BH20-01A, BH20-01B, BH20-02A, and BH20-02B). BH20-01 and BH20-02 were found blocked at 3.0 m below ground surface in October 2021 and May 2025 respectively. **Figure 1** attached provides a schematic of the site. The instruments were read by Akintola Fakinlede, GIT and Adham Zahr, Geotechnical EIT on October 2, 2025.

The slope inclinometers (SI) were measured using an RST MEMS digital inclinometer probe with 0.5 m increments and RST handheld PC. The standpipe piezometers (SP) were measured using a Heron Instruments water tape.

GPS coordinates of all instruments were obtained using a Garmin eTrex 10 handheld unit.

2.0 INSTRUMENTATION READINGS

2.1 GENERAL

The SI plots are provided in the attachments and summarized in the following sections. Displacement-time plots in the resultant x-direction (i.e., slope movement direction) along with movement rates, total cumulative movement, maximum movement rates, and incremental movements are provided in **Table NC081-1** and the attachments.

Standpipe piezometer results are summarized in **Table NC081-2** and in the following sections with resulting plots attached.

2.2 ZONES OF MOVEMENT

No discernable zone of movement was observed in SIs BH21-01 and BH21-02 which were installed in piles P27 and P57, respectively. However, small movements were observed at the pile tops. These movements may reflect deflection and loading of the pile wall.

October 31, 2025

Amy Driessen

Page 2 of 5

Reference: North Central Region, Edson/Stony Plain, Site NC081 – Highway 16A:08 Evansburg Slide, Fall 2025 Instrumentation Monitoring Report

2.3 MONITORING RESULTS

2.3.1 Slope Inclinometers

BH21-01 and BH21-02 have no discernable movement zones.

2.3.2 Piezometers

Compared with water levels from the previous reading cycle, all piezometers show a decrease in water levels ranging from 0.2 m to 0.4 m. The water levels at the site ranged from 2.5 m to 4.6 m below ground surface (bgs), with elevations ranging from 749.4 m to 751.8 m. For reference, the creek elevation is approximately 750 m.

3.0 RECOMMENDATIONS

It is recommended that the next reading cycle take place in Spring 2026.

3.1 INSTRUMENTATION REPAIRS

Currently, no instruments require repair.

October 31, 2025

Amy Driessen

Page 3 of 5

Reference: North Central Region, Edson/Stony Plain, Site NC081 – Highway 16A:08 Evansburg Slide, Fall 2025 Instrumentation Monitoring Report

Table NC081-1: Fall 2025 Slope Inclinometer Summary

Instrument Name	Date Initialized	Coordinates ⁽¹⁾ (UTM 11U, NAD1983) (m)		Total Cumulative Resultant Movement and Depth of Movement to Date (mm)	Maximum Rate of Movement (mm/yr)	Current Status	Date of Previous Reading	Incremental Movement Since Previous Reading (mm)	Current Rate of Movement (mm/yr)	Change in Rate of Movement Since Previous Reading (mm/yr)
		Northing	Easting							
BH20-01	Sept. 23, 2020	5941007	630594	19 mm over 1.2 m to 3.8 m depth in 15° direction	39 mm/yr; September 2021	Non-Operational	Sept. 7, 2021	Found blocked at 3.0 m in October 2021		
BH20-02	Sept. 23, 2020	5940983	630615	72 mm over 2.2 m to 4.2 m depth in 346° direction	68 mm/yr; September 2022	Non-Operational	Sep 23, 2024	Found blocked at 3.0 m in May 2025		
BH21-01 (P27)	Oct. 21, 2021	5941014	630595	No discernable movement zone.		Operational	May 8, 2025	No discernable movement zone.		
BH21-02 (P57)	Oct. 21, 2021	5941016	630618	No discernable movement zone.		Operational	May 8, 2025	No discernable movement zone.		
(1) Operational instruments updated on October 2, 2025, with approximate accuracy of ± 3 m										

October 31, 2025

Amy Driessen

Page 4 of 5

Reference: North Central Region, Edson/Stony Plain, Site NC081 – Highway 16A:08 Evansburg Slide, Fall 2025 Instrumentation Monitoring Report

Table NC081-2: Fall 2025 Standpipe Piezometer Readings Summary

Instrument Name	Date Initialized	Coordinates ⁽¹⁾ (UTM 11U, NAD1983) (m)		Bottom Depth (mbgs), (Elevation)	Current Status	Maximum Water Level (m bgs)	Measured Water Level (Fall 2025) (m bgs), (Elevation)	Previous Water Level (Spring 2025) (Elevation), (m bgs)	Change in Water Level (m) ⁽²⁾
		Northing	Easting						
BH20-01A	Sept. 23, 2020	5941006	630595	6.0 (749.7 m)	Operational	1.2 (May 2025)	4.0 (751.8 m)	3.7 (752.0 m)	-0.2
BH20-01B	Sept. 23, 2020	5941006	630595	10.1 (745.6 m)	Operational	3.9 (October 2020)	4.6 (751.1 m)	4.4 (751.4 m)	-0.2
BH20-02A	Sept. 23, 2020	5940984	630614	6.9 (745.7 m)	Operational	2.7 (May 2022)	3.2 (749.4 m)	2.9 (749.7 m)	-0.3
BH20-02B	Sept. 23, 2020	5940984	630614	4.8 (747.8 m)	Operational	1.7 (May 2022)	2.5 (750.0 m)	2.2 (750.4 m)	-0.4
(1) Operational instruments updated on October 2, 2025, with approximate accuracy of ± 3 m									
(2) Negative (-) indicates decrease in water level									

October 31, 2025

Amy Driessen

Page 5 of 5

Reference: North Central Region, Edson/Stony Plain, Site NC081 – Highway 16A:08 Evansburg Slide, Fall 2025 Instrumentation Monitoring Report

4.0 CLOSING


We trust this instrumentation report meets your requirements. If you have any questions, please do not hesitate to contact the undersigned.

Stantec Consulting Ltd.


Leslie Cho M.Eng., P.Eng.
Senior Associate, Geotechnical Engineer
Phone: 780-917-7403
leslie.cho@stantec.com

Lawrence Onwude M.Eng., P.Eng.
Senior Associate, Geotechnical Engineer
Phone: 780-969-2257
lawrence.onwude@stantec.com

Attachment: Figure 1 – Site Plan
BH21-01 Slope Inclinator Plots
BH21-02 Slope Inclinator Plots
Standpipe Piezometer Level Depth vs Time Plot
Standpipe Piezometer Level Elevation vs Time Plot

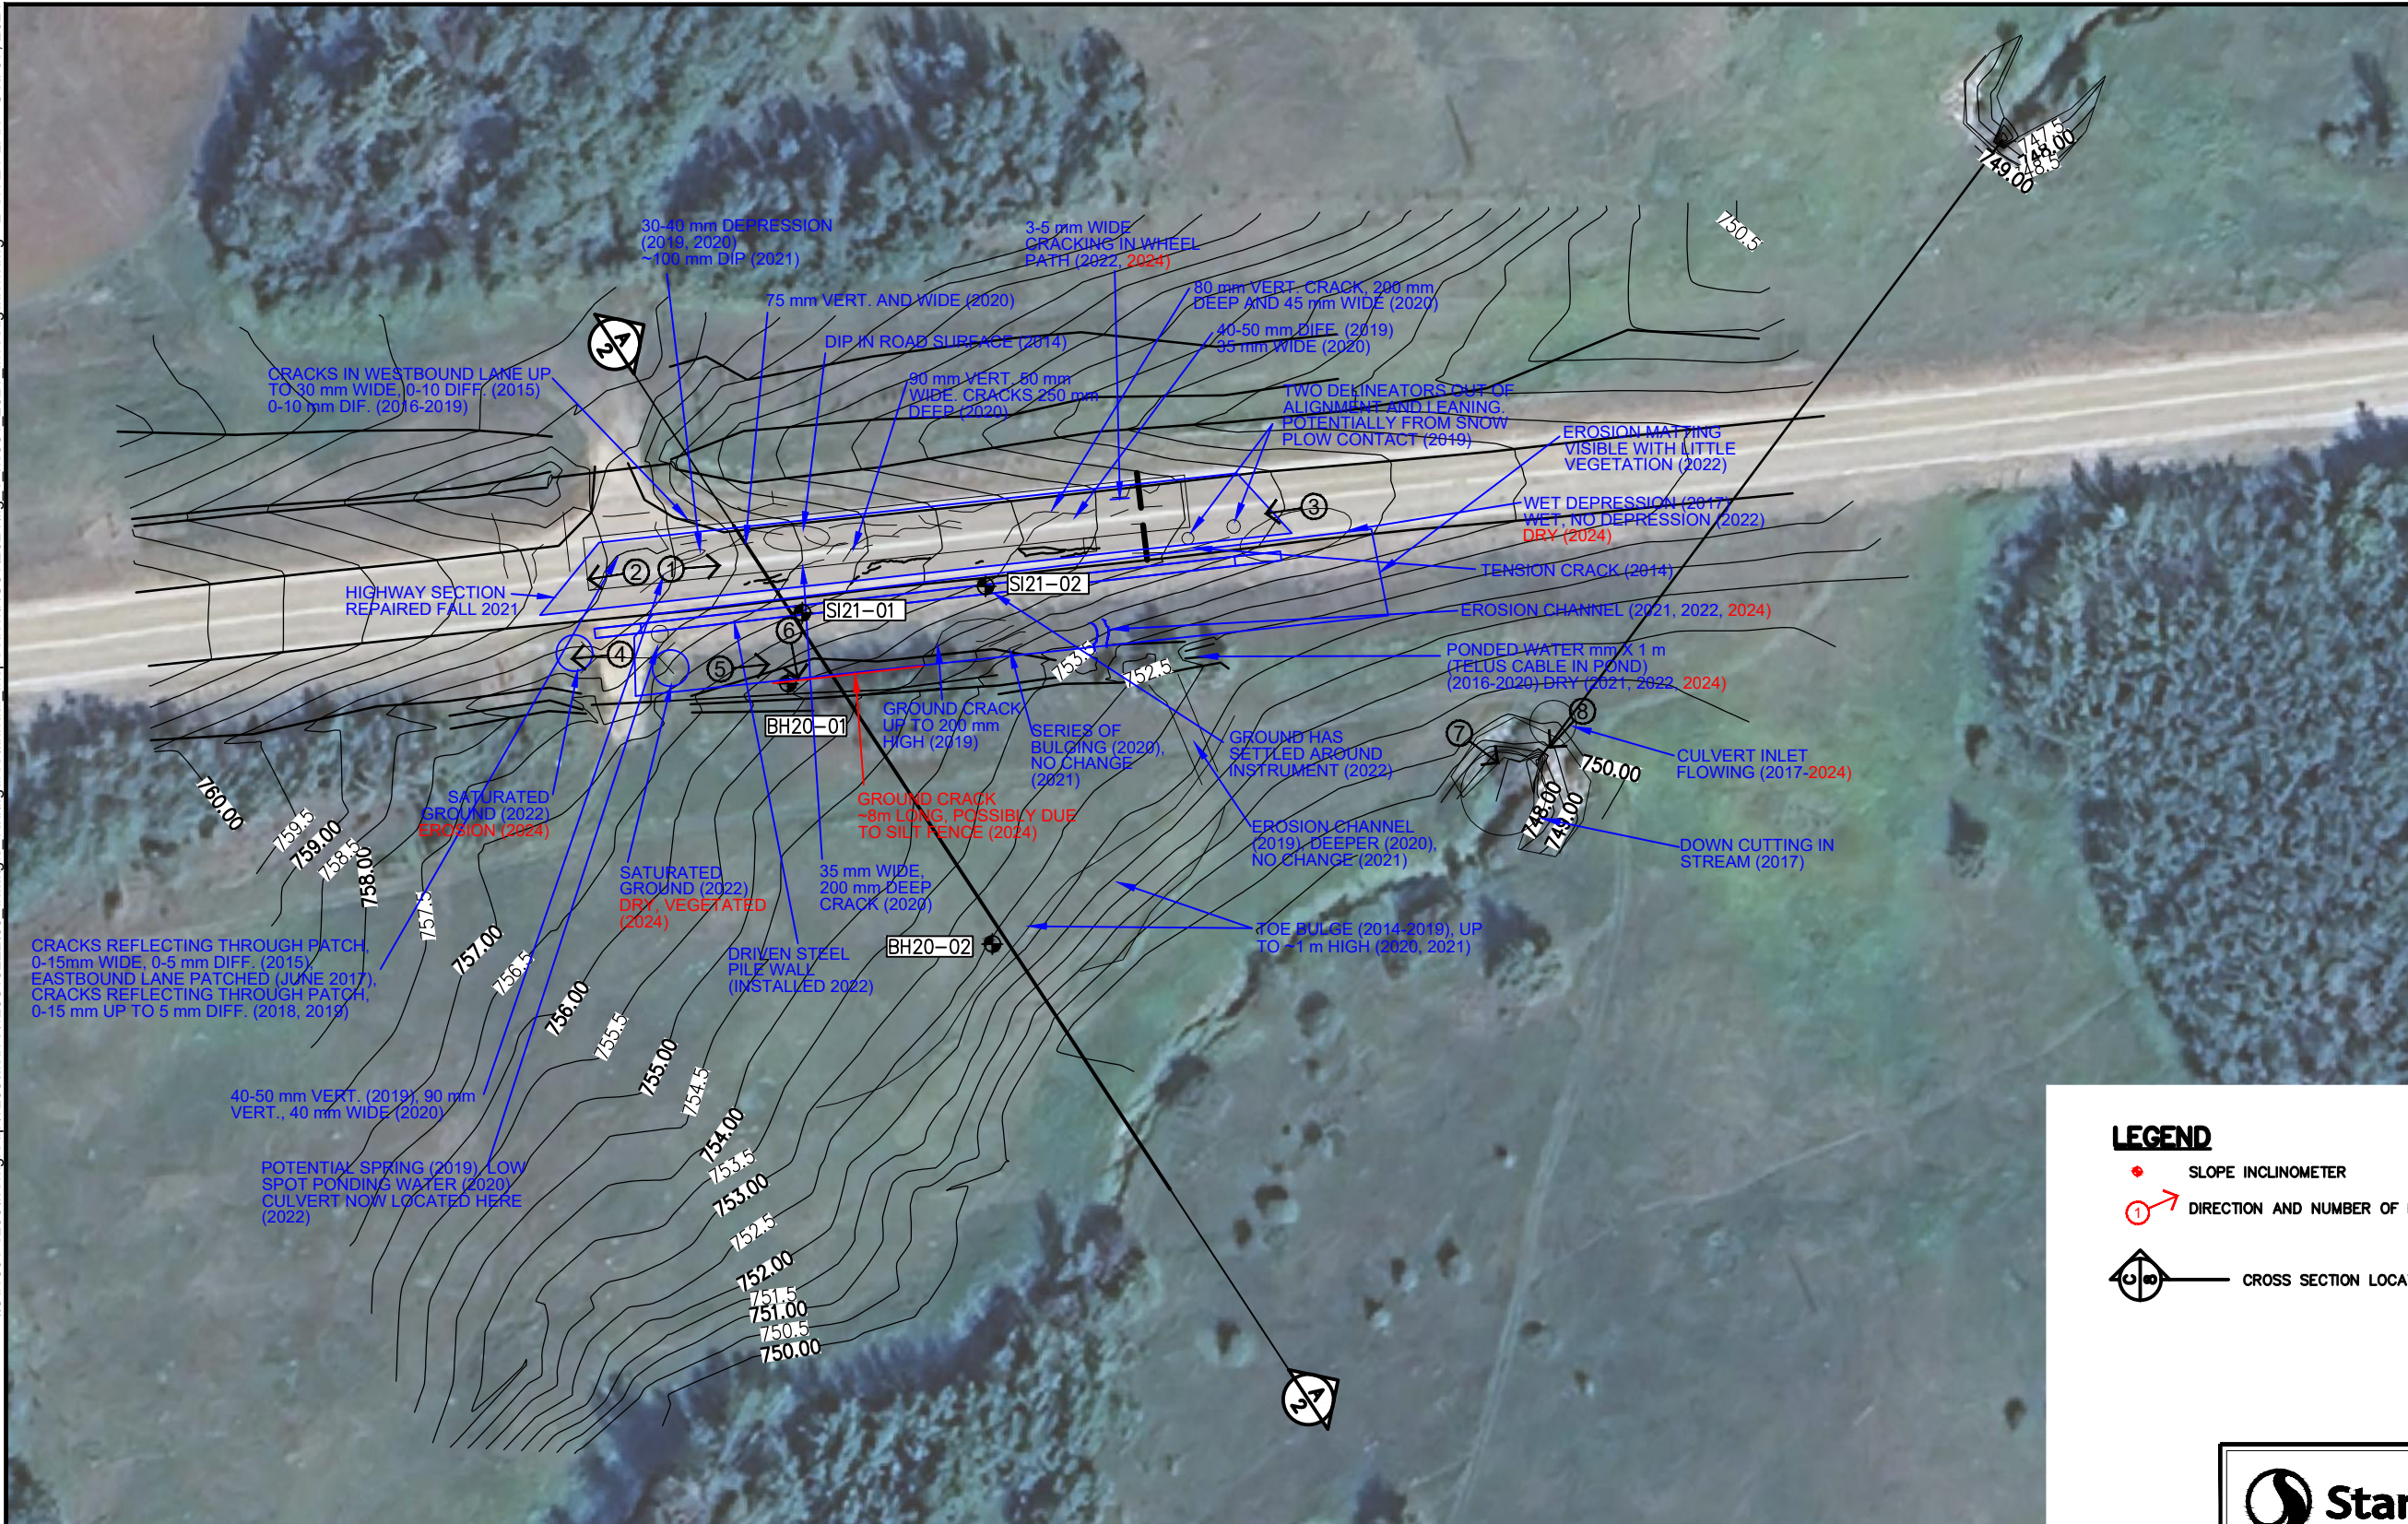

Stantec Consulting Ltd - Edmonton

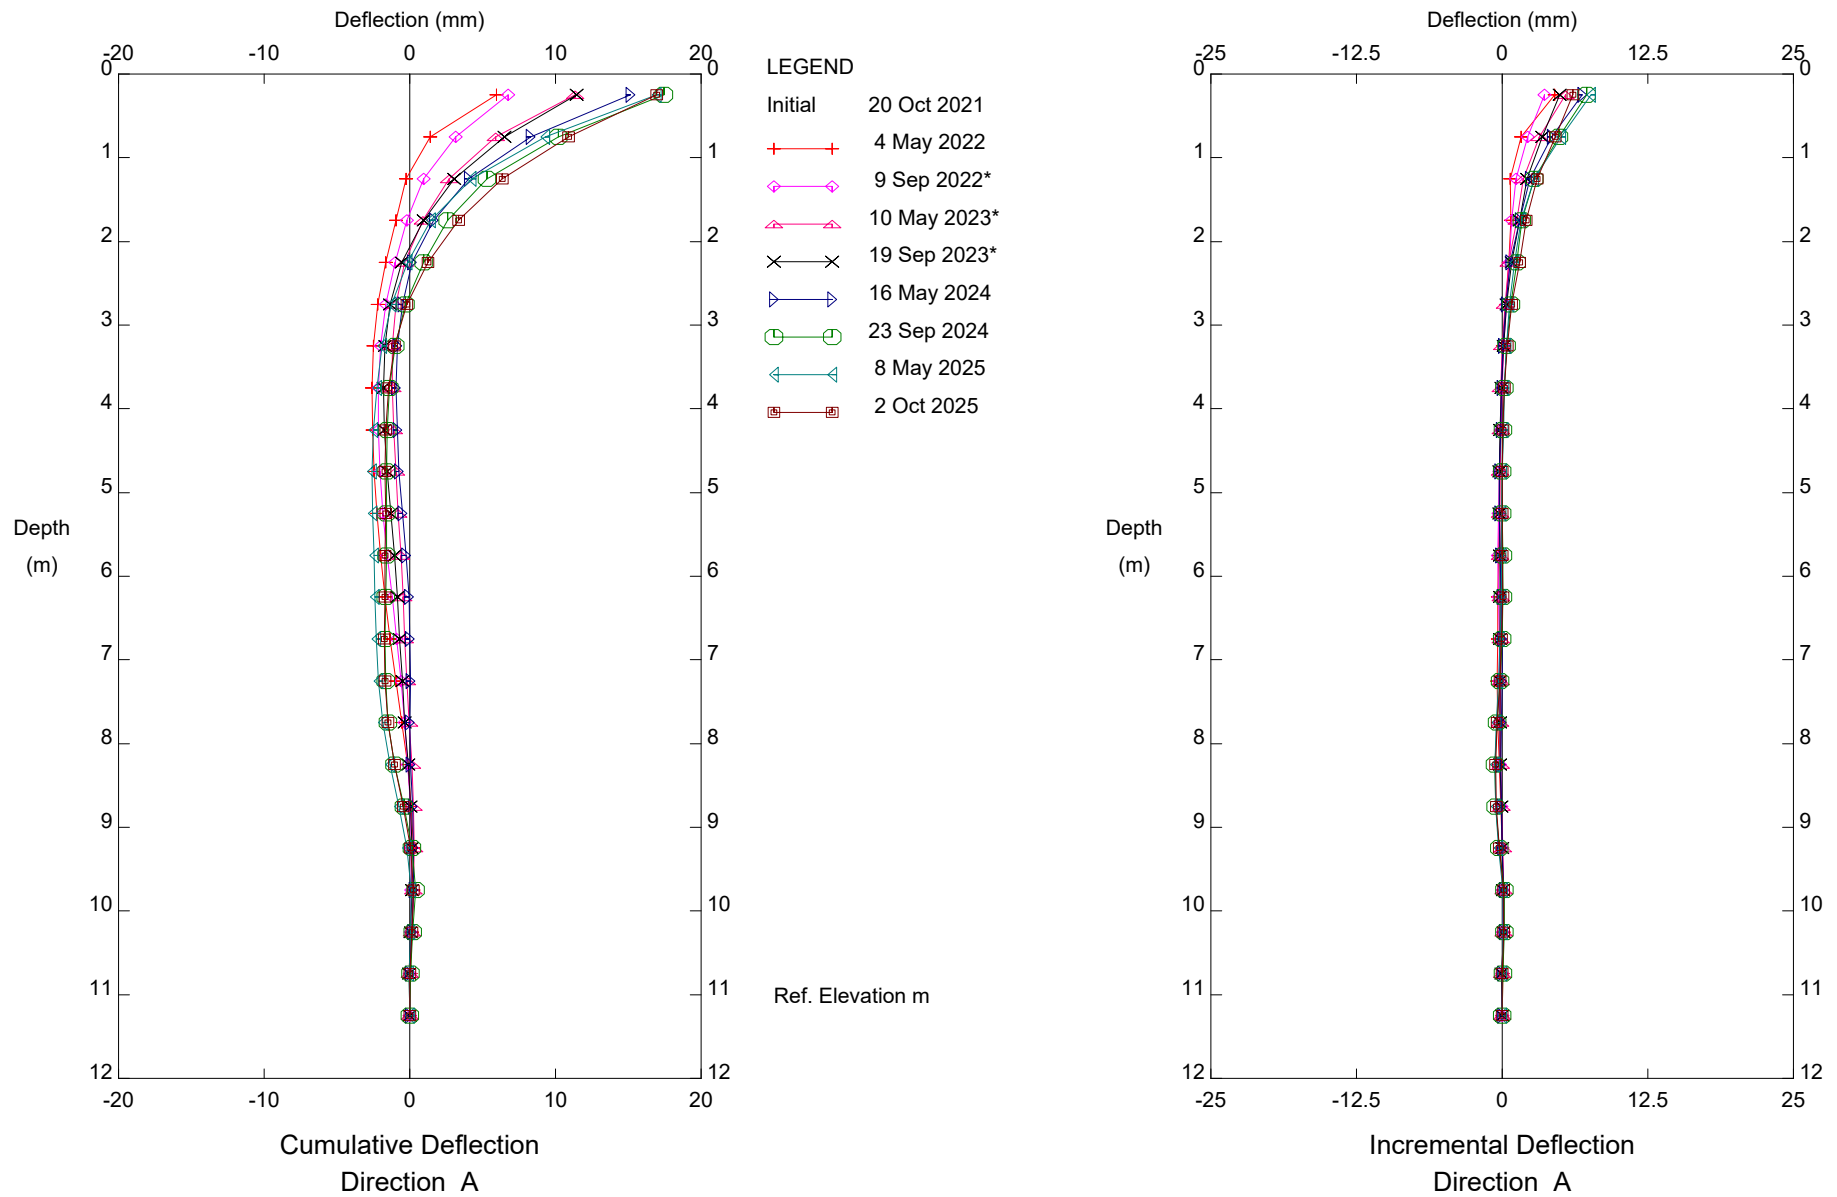


NC81 - 16A Evansburg, Inclinometer SI 21-01,P27

Transportation & Economic Corridors

Sets marked * include zero shift and/or rotation corrections.

Stantec Consulting Ltd - Edmonton

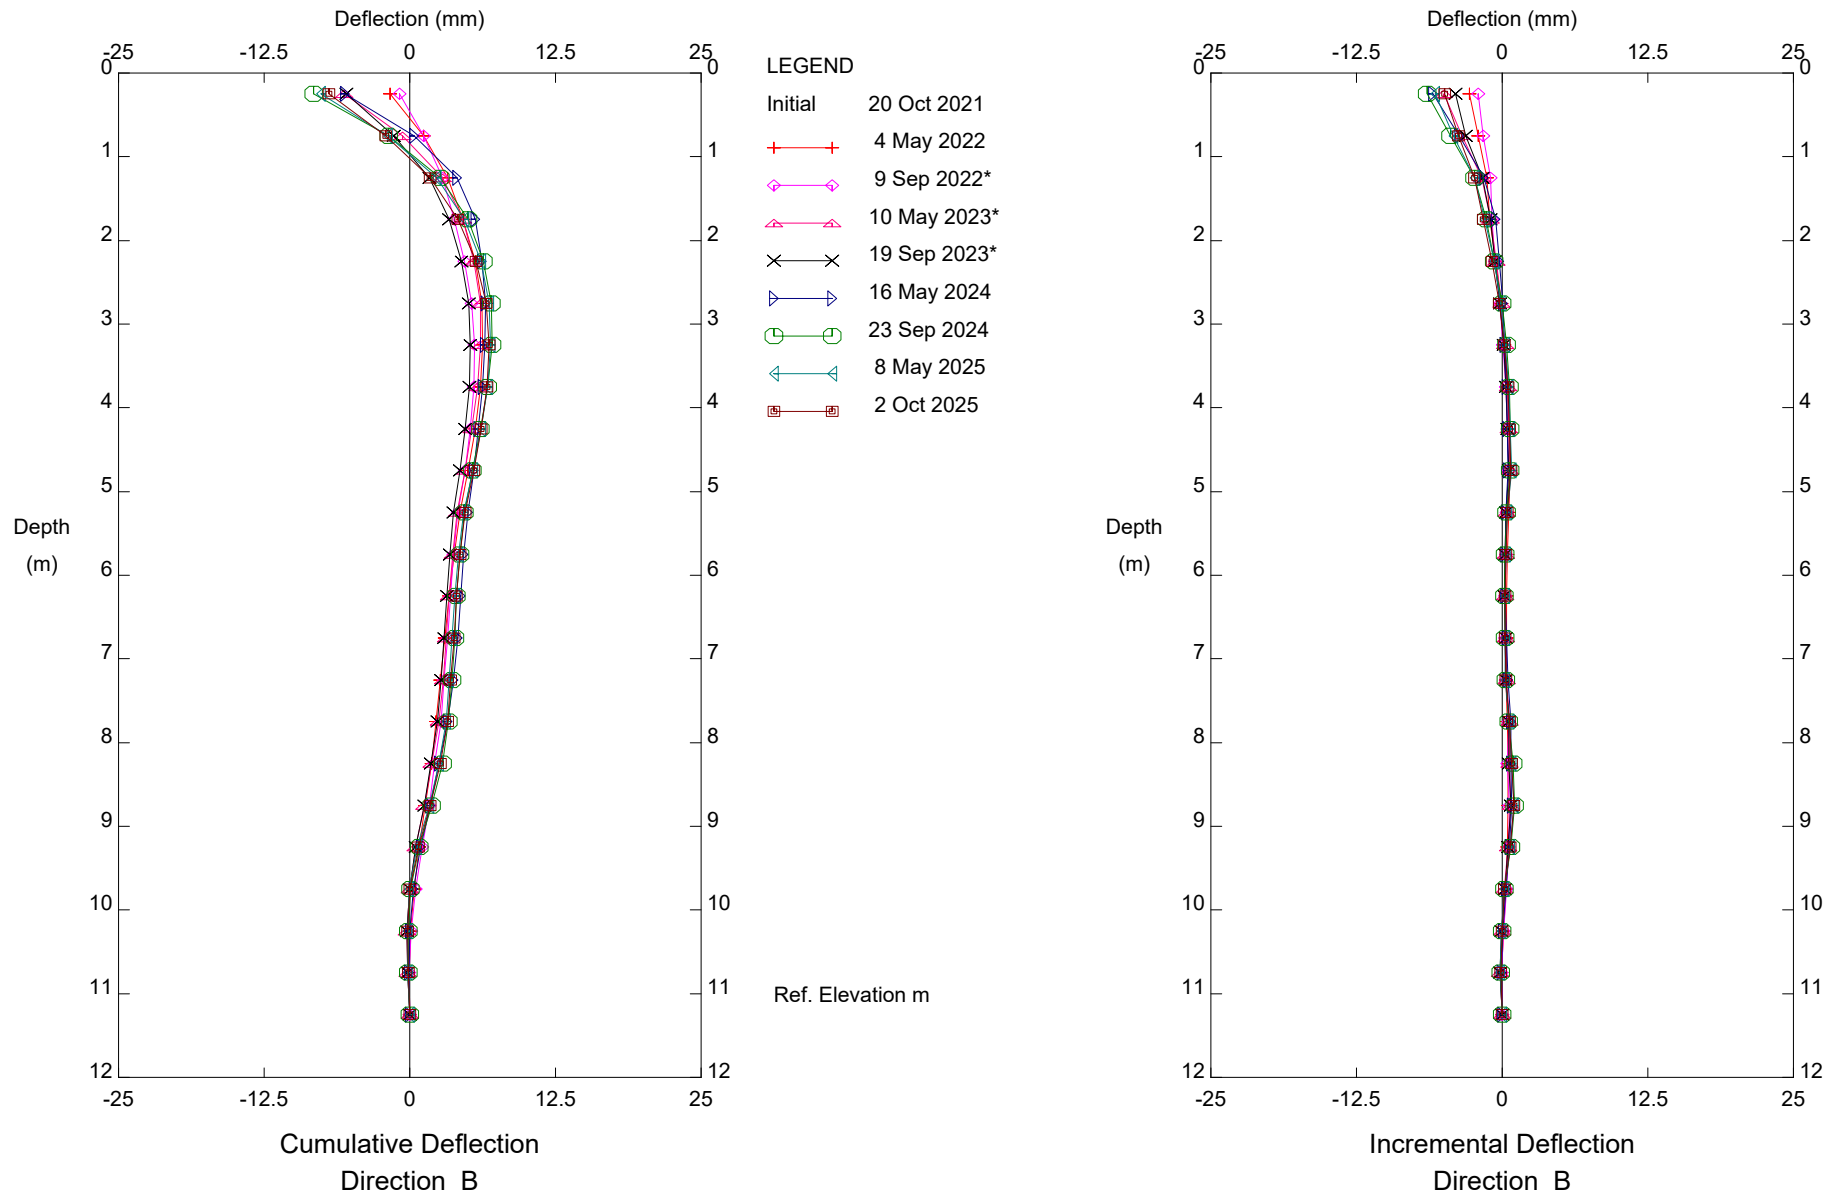


NC81 - 16A Evansburg, Inclinometer SI 21-01,P27

Transportation & Economic Corridors

Sets marked * include zero shift and/or rotation corrections.

Stantec Consulting Ltd - Edmonton

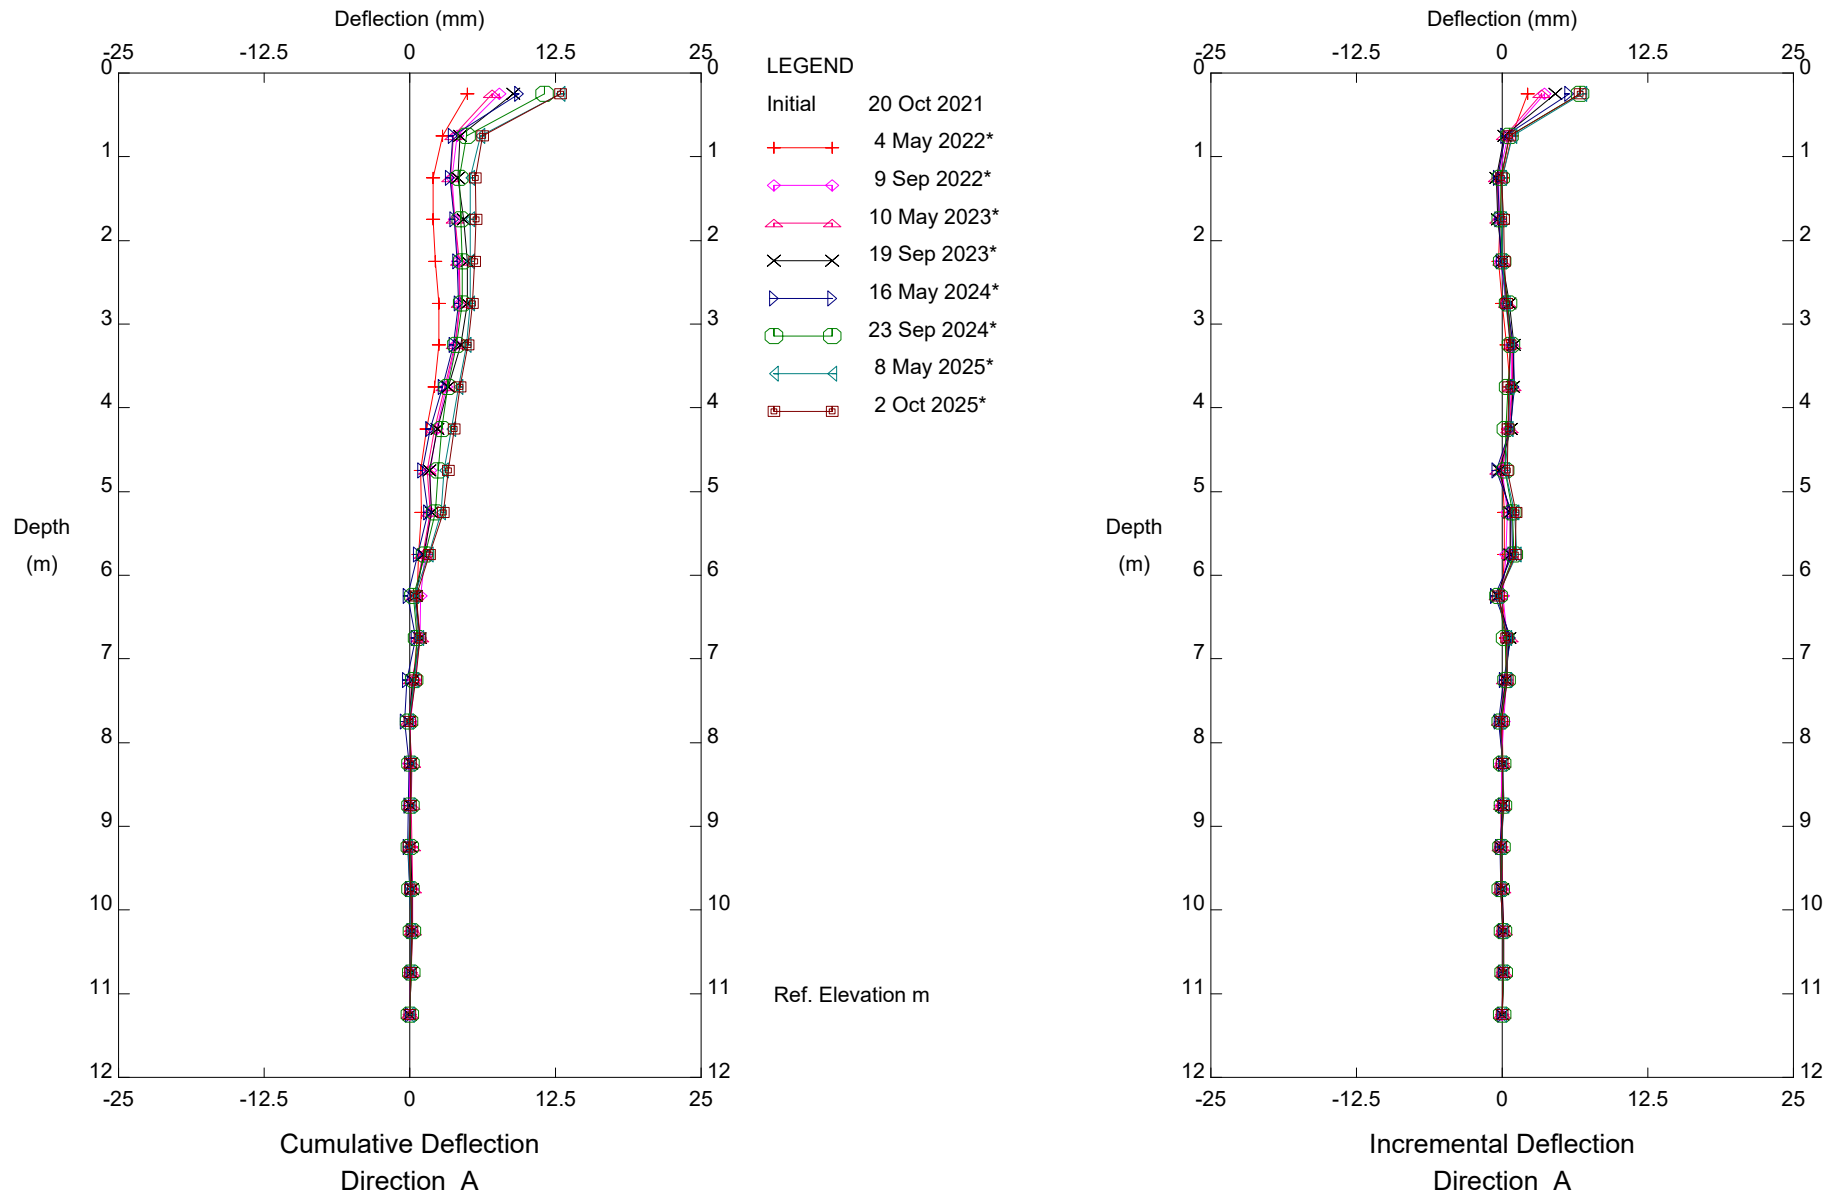


NC81 - 16A Evansburg, Inclinator SI 21-02,P57

Transportation & Economic Corridors

Sets marked * include zero shift and/or rotation corrections.

Stantec Consulting Ltd - Edmonton

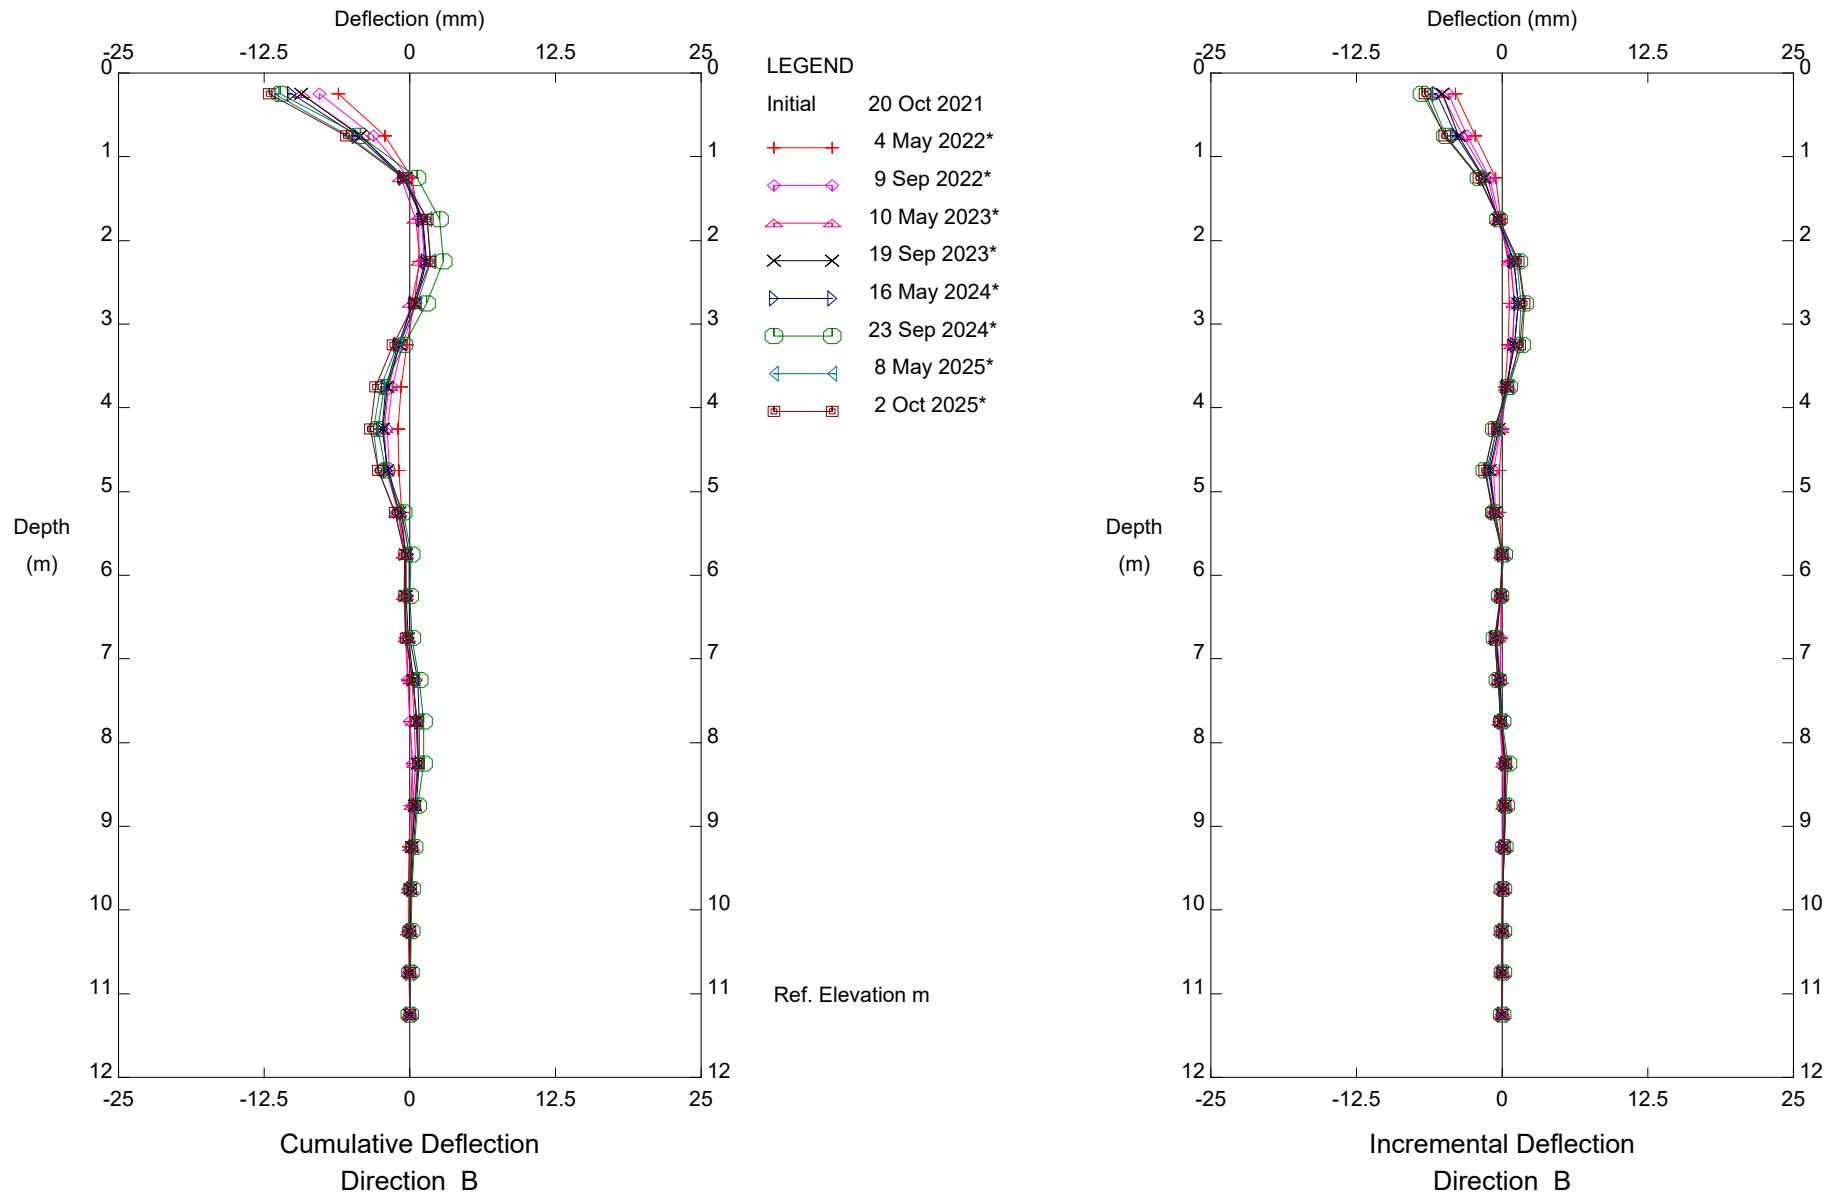


NC81 - 16A Evansburg, Inclinator SI 21-02,P57

Transportation & Economic Corridors

Sets marked * include zero shift and/or rotation corrections.

Stantec Consulting Ltd - Edmonton

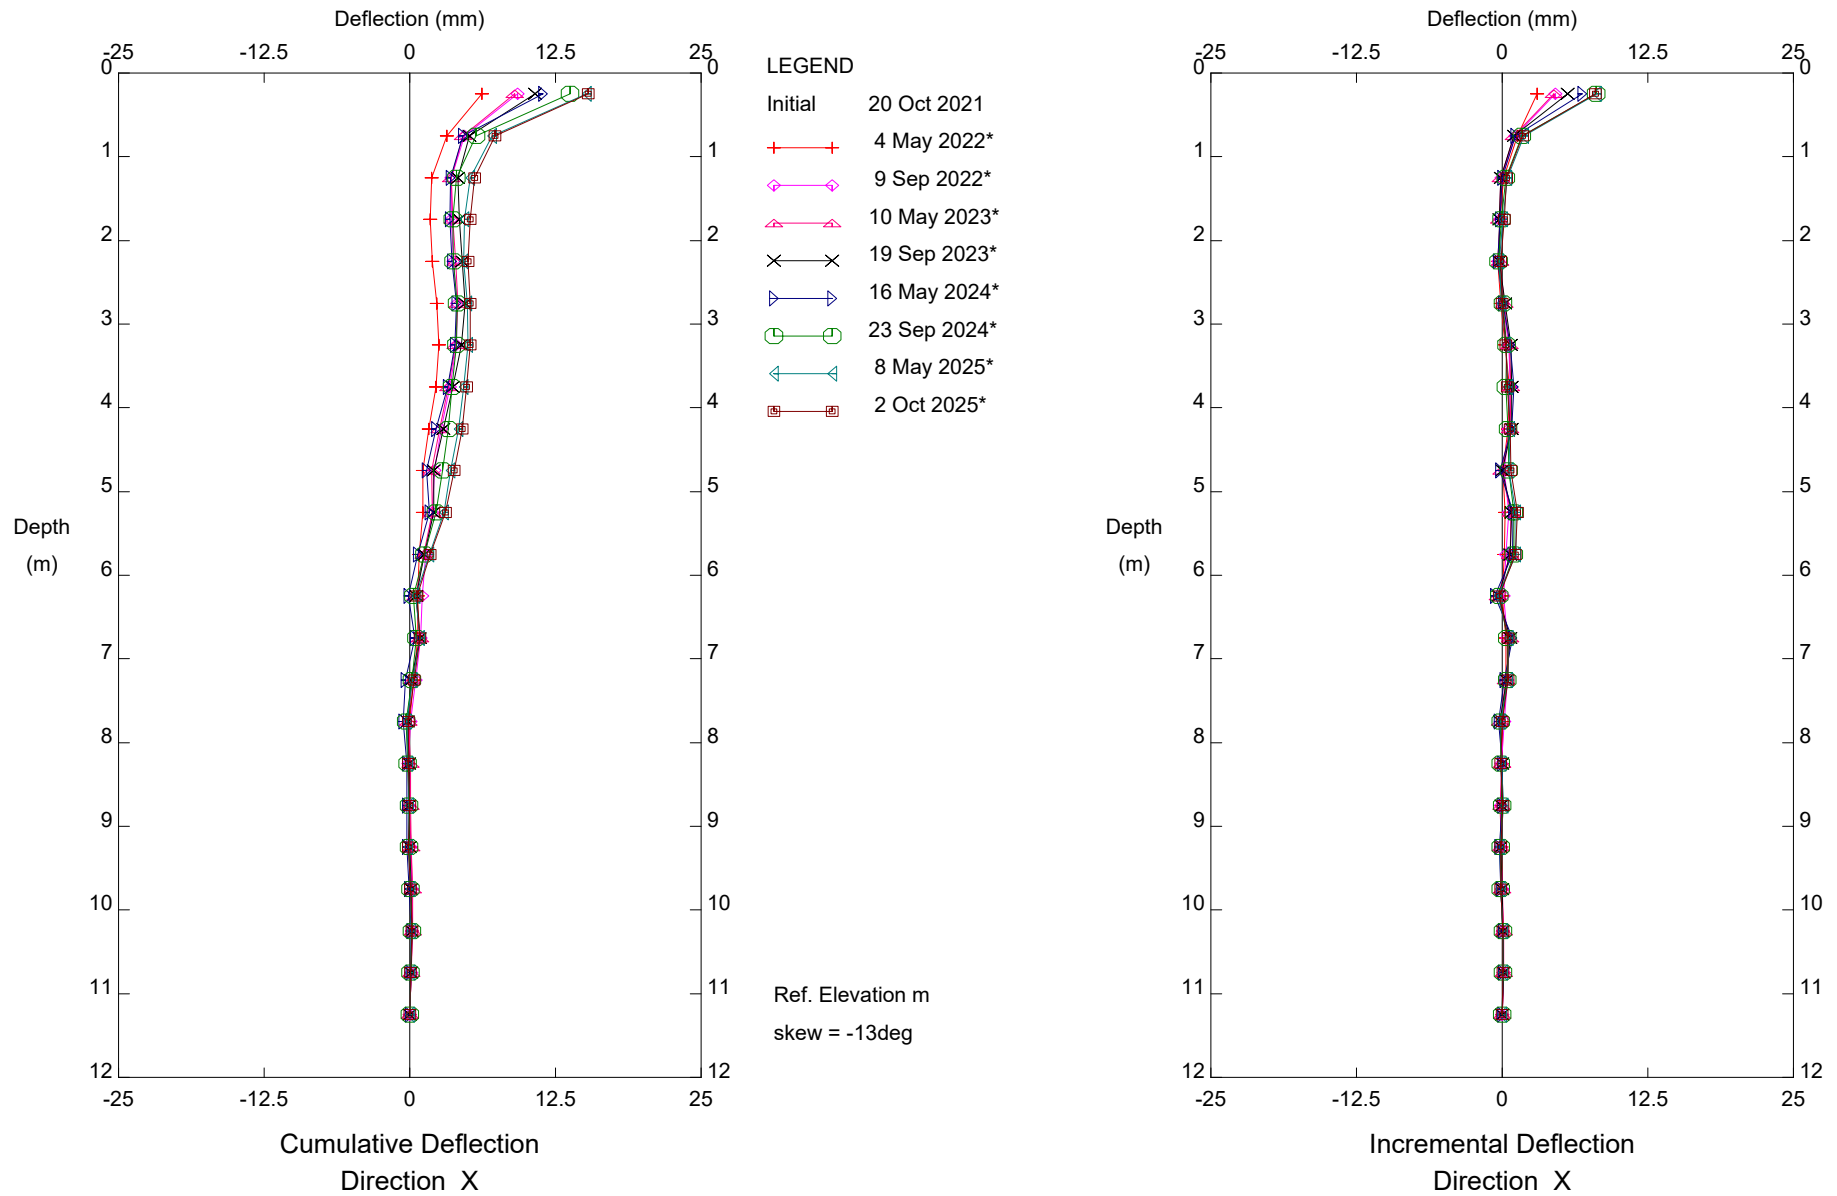


NC81 - 16A Evansburg, Inclinometer SI 21-02,P57

Transportation & Economic Corridors

Sets marked * include zero shift and/or rotation corrections.

V:\1233\active\123315222\03_data\field\instrumentation\NC081\Borehole_21-02\2025_fall\NC81_BH21-S2_S2025.gtl

PIEZOMETER DATA

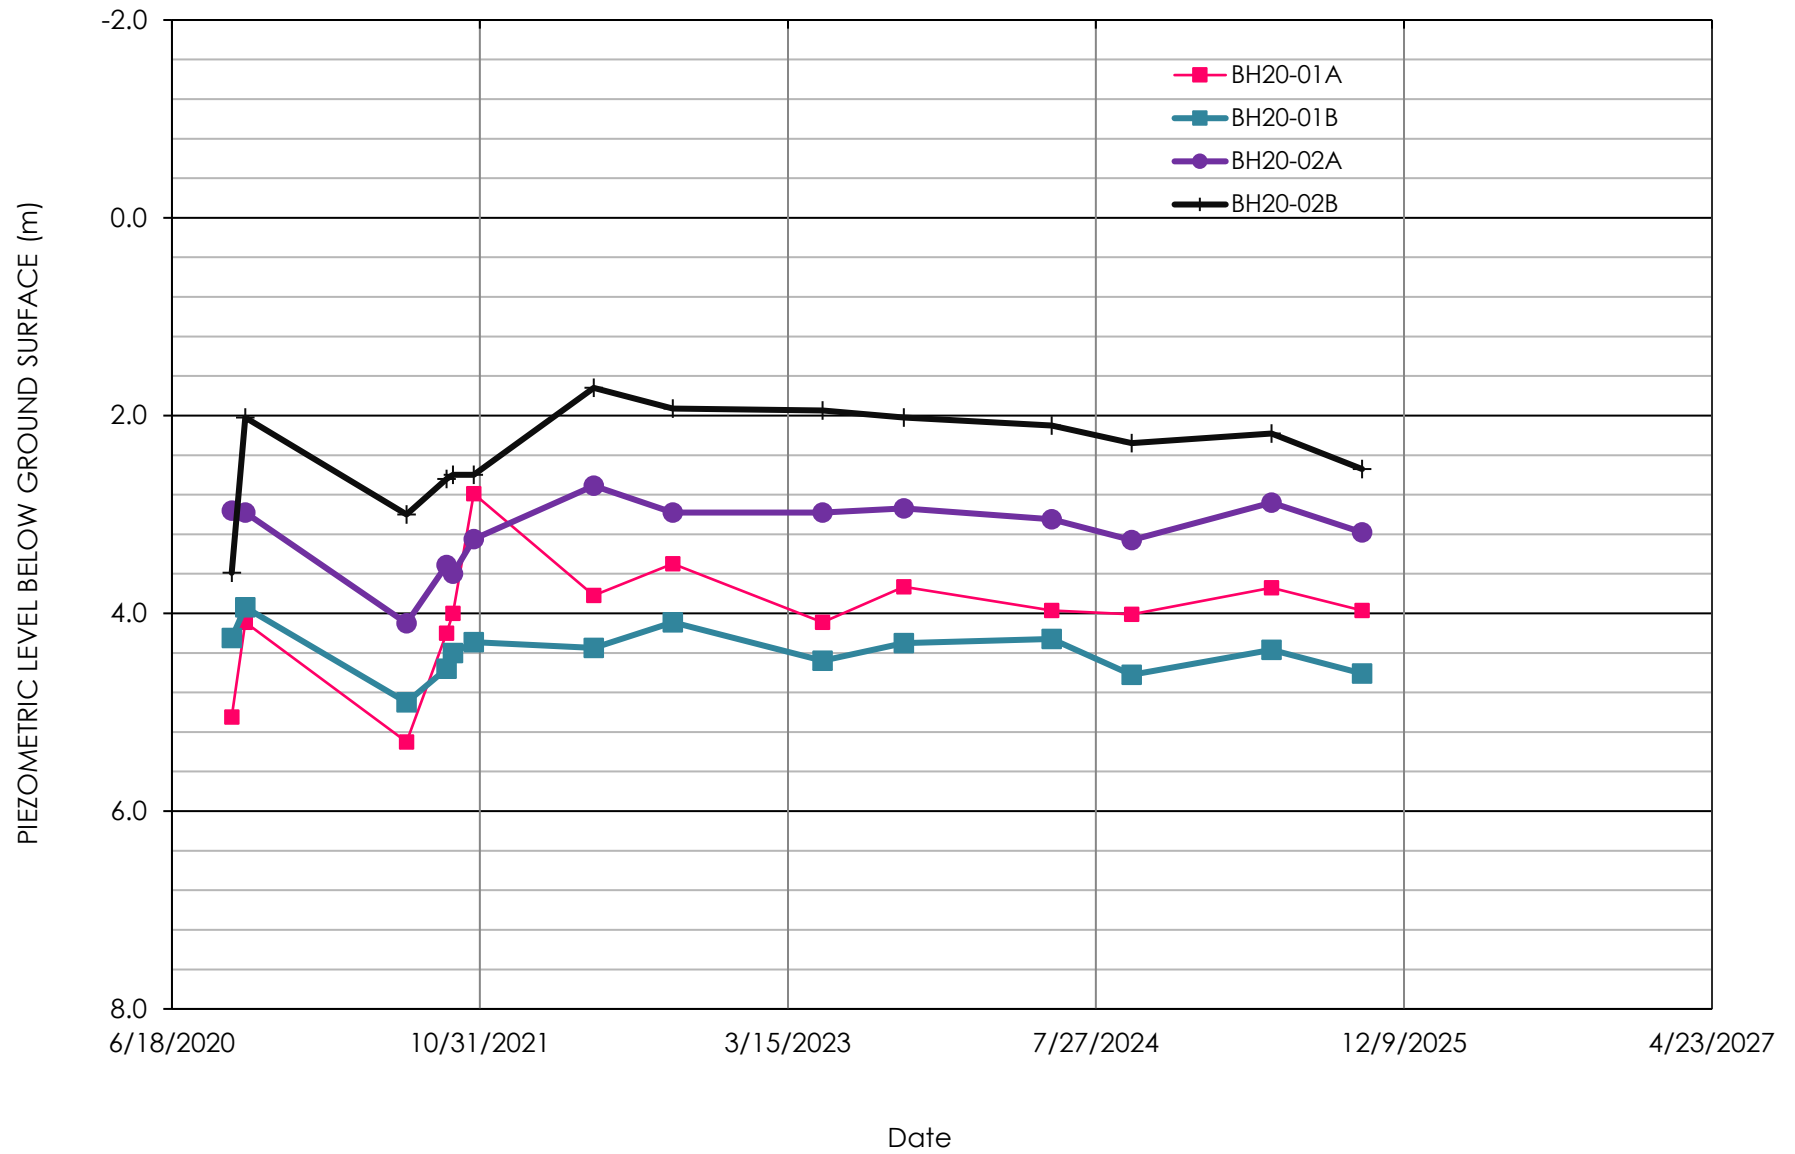

PIEZOMETER DATA

